
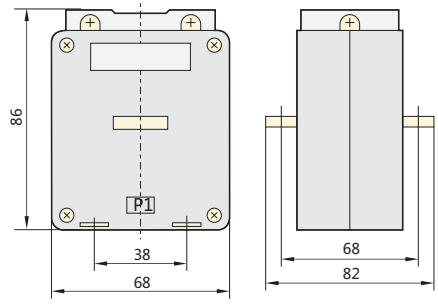

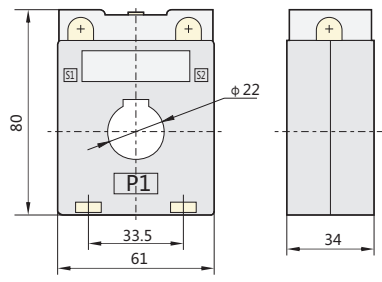

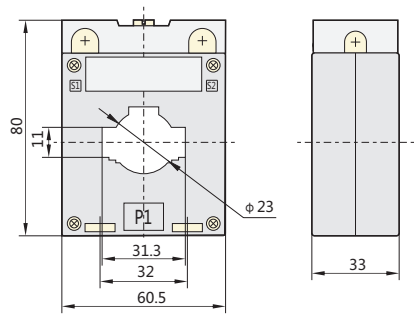

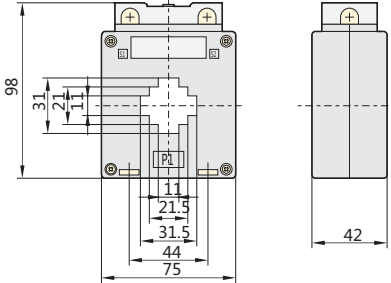

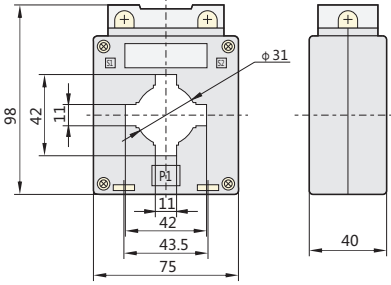


4. Technical data

Model	Transformation ratio(I _{pn} /I _{sn}) (A)	Power(VA)		Accuracy class			Number of turns through iron core	Overall and installing dimensions (mm)
		1	0.5	0.5S	0.2	0.2S		
 BH-0.66 Solid type	5/5	2.5	2.5					
	10/5	2.5	2.5					
	15/5	2.5	2.5					
	20/5	2.5	2.5					
	25/5	2.5	2.5					
	30/5	2.5	2.5					
	40/5	2.5	2.5					
	50/5	2.5	2.5					
	75/5	2.5	2.5					
	5/1	2.5	2.5					
	10/1	2.5	2.5					
	15/1	2.5	2.5					
	20/1	2.5	2.5					
	25/1	2.5	2.5					
	30/1	2.5	2.5					
	40/1	2.5	2.5					
50/1	2.5	2.5						
75/1	2.5	2.5						
 BH-0.66 20I	75/5	2.5						
	100/5	2.5						
	75/1	2.5	1					
	100/1	2.5	1					
 BH-0.66 30I	30/5	2.5	2.5					
	50/5	2.5	2.5					
	75/5	2.5	2.5					
	100/5	2.5						
	100/5	5	5					
	150/5	2.5	2.5					
	200/5	5	5					
	250/5	5	5					
	300/5	5	5					
	400/5	5	5					
	30/1	2.5	2.5					
	50/1	2.5	2.5					
	75/1	2.5	2.5					
	100/1	2.5	1					
100/1	5	5						
150/1	2.5	2.5						
200/1	5	5						
250/1	5	5						
300/1	5	5						

Model	Transformation ratio(I _p n/I _s n) (A)	Power(VA)		Accuracy class			Number of turns through iron core	Overall and installing dimensions (mm)	
		1	0.5	0.5S	0.2	0.2S			
 BH-0.66 30IB	30/5	5	2.5	2.5	2.5	2.5	5		
	50/5	5	2.5	2.5	2.5	2.5	3		
	75/5	5	2.5	2.5	2.5	2.5	2		
	75/5	5	2.5	2.5	2.5	2.5	1		
	100/5	5	2.5	2.5	2.5	2.5	1		
	100/5	5	5	5	5	5	2		
	150/5	5	2.5	2.5	2.5	2.5	1		
	200/5	5	5	5	5	5	1		
	250/5	5	5	5	5	5	1		
	300/5	5	5	5	5	5	1		
	30/1	2.5	1						5
	50/1	2.5	1						3
	75/1	5	2.5						2
	100/1	5	2.5						2
	150/1	5	2.5						1
	200/1	5	5						1
250/1	5	5					1		
 BH-0.66 40I	30/5	2.5	2.5	2.5	2.5	2.5	5		
	50/5	2.5	2.5	2.5	2.5	2.5	3		
	75/5	2.5	2.5	2.5	2.5	2.5	2		
	100/5	2.5					1		
	100/5	5	5	5	5	2.5	2		
	150/5	2.5	2.5	2.5	2.5	2.5	1		
	200/5	5	5	5	5	2.5	1		
	250/5	5	5	5	5	2.5	1		
	300/5	5	5	5	5	5	1		
	400/5	5	5	5	5	5	1		
	500/5	10	10	5	5	5	1		
	600/5	10	10	5	5	5	1		
	30/1	5	2.5	5	5	5	5		
	50/1	5	2.5						3
	75/1	5	2.5						2
	100/1	5	5						2
150/1	5	2.5					1		
200/1	5	5					1		
250/1	5	5					1		
300/1	5	5					1		
400/1	5	5					1		
500/1	10	10					1		

